

TITLE SHEET

DEPARTMENT OF HIGHWAYS STATE OF COLORADO

RIGHT OF WAY PLAN OF PROPOSED FEDERAL AID PROJECT NO. C-05-0389- STATE HIGHWAY NO. 389 LAS ANIMAS COUNTY RIGHT OF WAY

INFORMATION OBTAINED FROM AVAILABLE COUNTY RECORDS

SCALE OF ORIGINAL DRAWING
ON PLAN, 1" = 100'
LENGTH OF PROJECT = 1.777 MILES (ROW)

FEDERAL ROAD REGION NO.	DIVISION	PROJECT NO.	SHEET NO.
9	COLORADO	C-05-0389-	1



RIGHT OF WAY BRANSON SOUTH TO STATE LINE

INDEX OF SHEETS

SHEET NO.

1
2
3-6

TITLE SHEET
TABULATION OF PROPERTIES
PLAN & PROFILE SHEETS

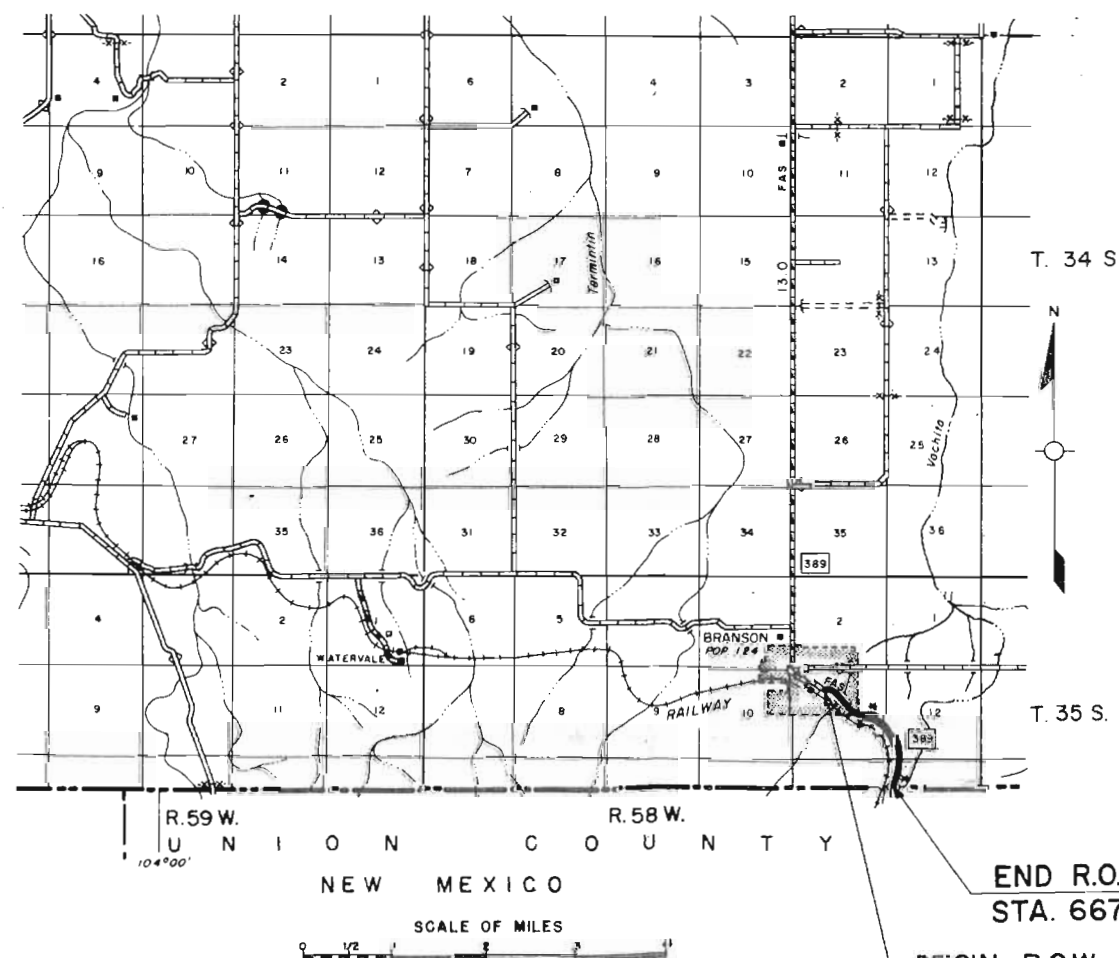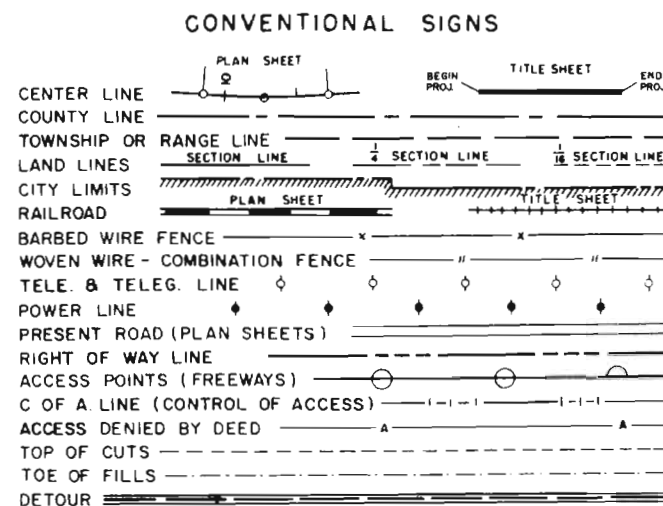

END R.O.W. C-05-0389-
STA. 667+34.0

BEGIN R.O.W. C-05-0389-
STA. 584+51.2

FILE COPY
DO NOT REMOVE

REVISIONS	


FED. ROAD DIST. NO.	STATE	PROJ. NO.	SHEET NO.	TOTAL SHEETS
3	COLO.	C-05-0389-	3	

NE 1/4 Sec. 11
T 35 R 57 W

BEGIN R.O.W. C-05-0389-
STA. 584+51.2

LENGTH of PROJECT
9,452' = 1.79 Miles
Total Cover 15"
Curve "A"

This Section corner was re-established by centering between property fences paralleling Section lines both North, South and East, West

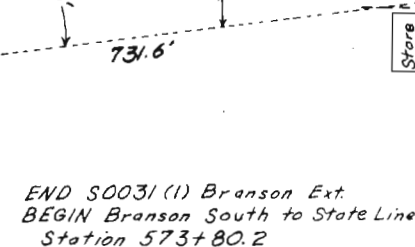

DRAINAGE NOTE

All RR Structures have been checked for drainage capacity & found to be adequate. Also area between RR Structures & Roadway structures has been considered in determining size of Structure at roadway. High water marks on structures is approximately one half capacity of structures.

#4 B.M. 6365.82 ~ 582475
90' Pt. nail in Bldg

RR Structure 6'x8" CBO
Rt 587+00 Drains thru
Roadway Sta. 589+

Vol. 1	15 Sept.
LC 46.9	
MS 24.5	
% 100 84.0	
BE = 2.5	
47-6 (15)	

#5 B.M. 6353.79 ~ 591410
63' Lt. H&G in fence line

#6 B.M. 6360.55 ~ 598+00

Rt 600+00 Drains thro
Roadway Str. 594+

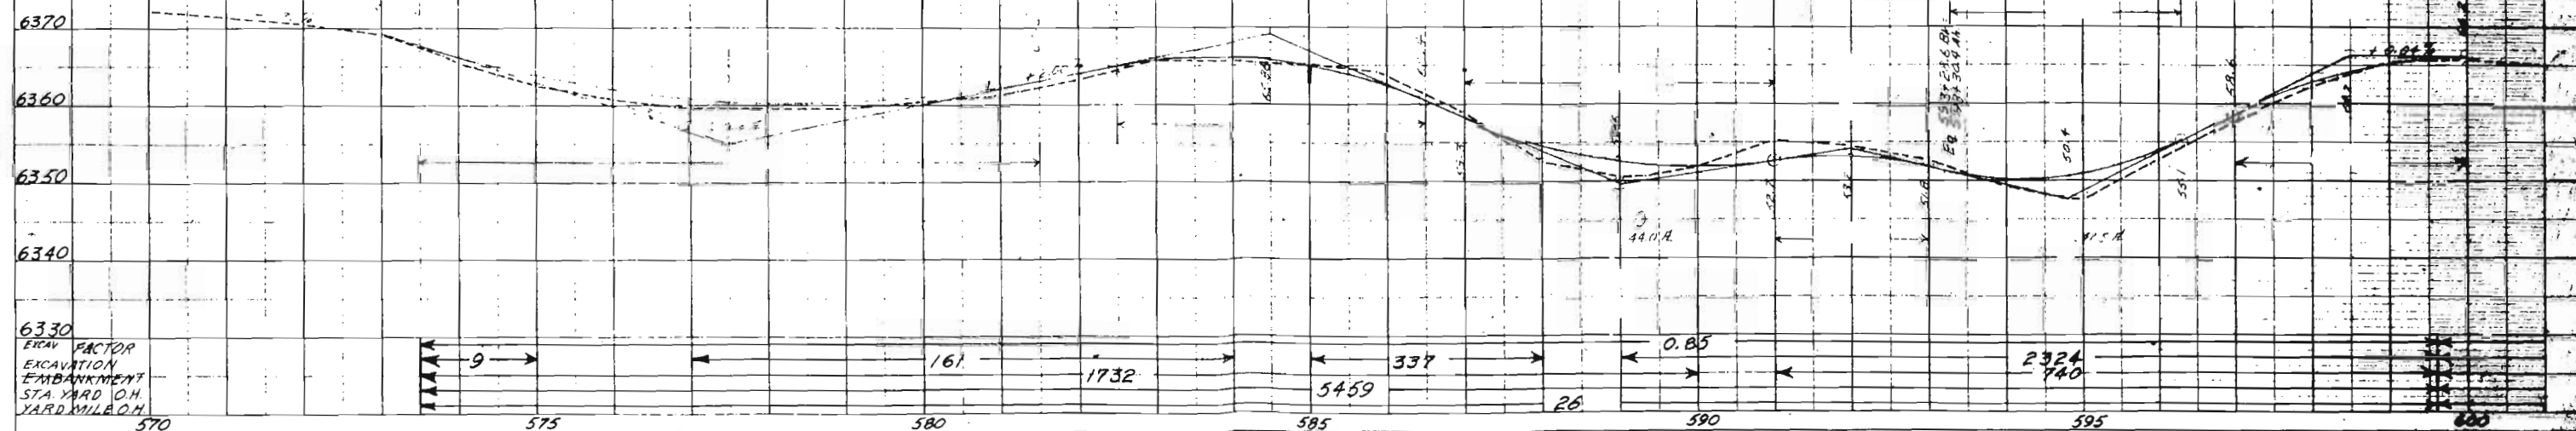
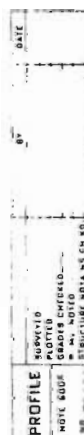


PLATE 1 PLAN PROFILE B B D STANDARD
HILL PAPERS NO. 1000 CENTER IN C. S. A.
A. LUCENT. NEW YORK, N.Y.

PLAN	DATE
DESIGNED BY	BY
CHECKED BY	DATE
NOTED BY	
BY	

PROFILE	DATE
DESIGNED BY	BY
CHECKED BY	DATE
NOTED BY	
BY	


FED. ROAD DIST. NO.	STATE	PROJ. NO.	SHEET NO.	TOTAL SHEETS
3	COLO.	C-05-0389-	4	

Branson South to State Line

SW 1/4 Sec. 12
T 35, R 58W

OWNER
John & W.M. Doherty
Branson, Colo.

OWNER
EL. Seay
Branson, Colo.

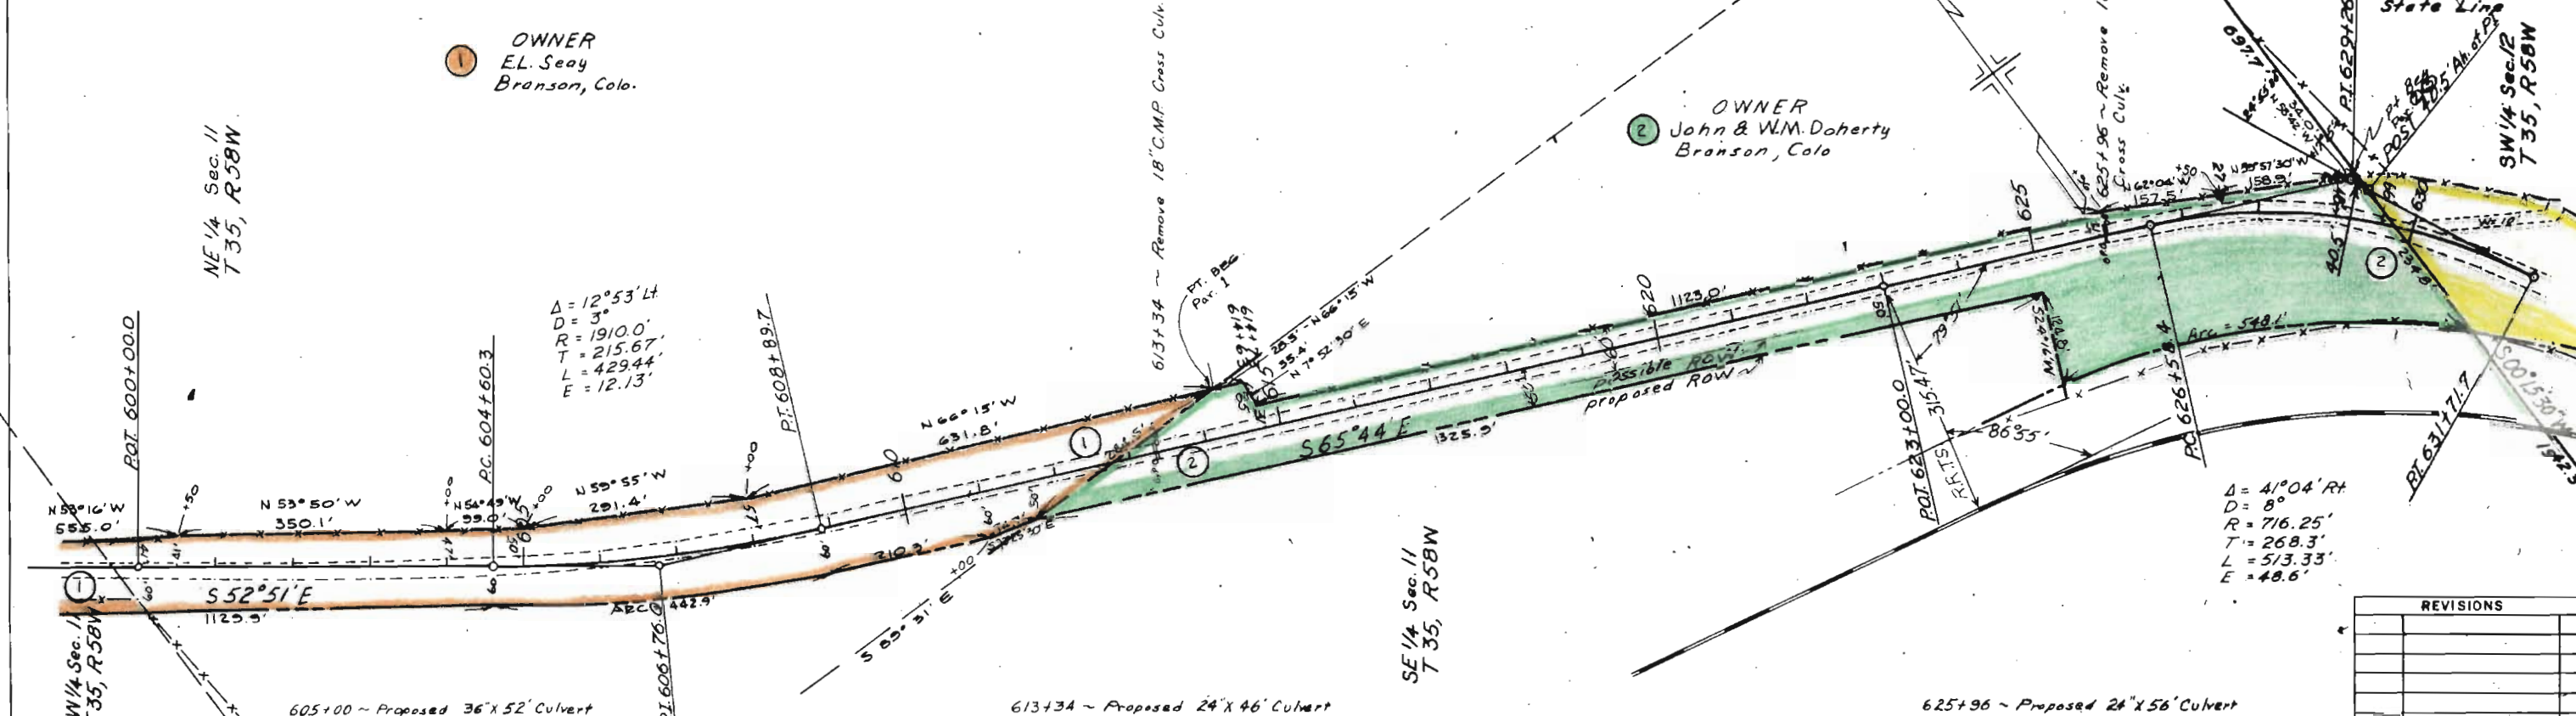

REVISIONS

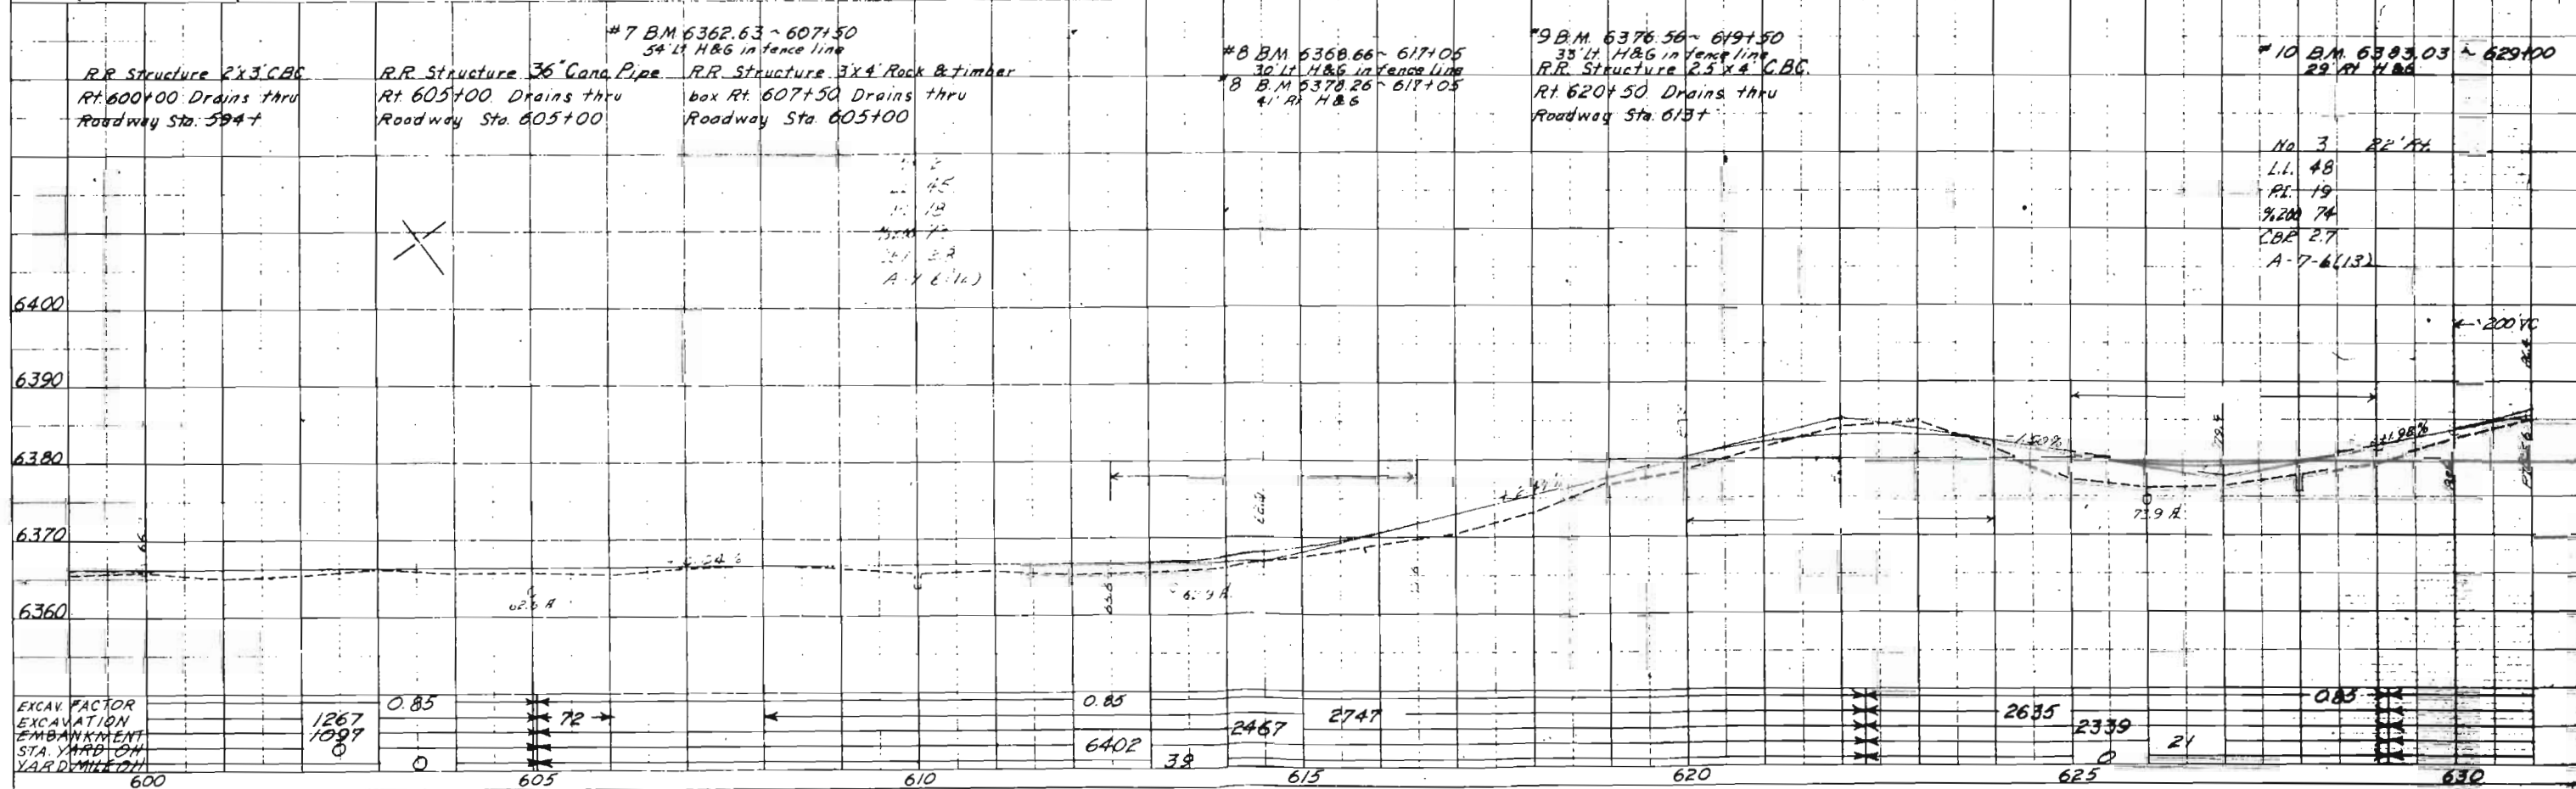


PLATE 1: PLAN/PROFILE 8' x 11' STANDARD
1:20 HORIZ. SCALE, 1" = 10' VERT. SCALE
CURVE DETAIL: 60'

FED. ROAD DIST. NO.	STATE	PROJ. NO.	SHEET NO.	TOTAL SHEETS
3	COLO.	C-05-0389-	5	

Branson South to State Line

REVISIONS

OWNER
Lawrence Horner
Branson, Colo

OWNER
Lawrence Horner
Branson, Colo

OWNER
John & W. M. Doherty
Branson, Colo

Bearing S 21° 48' E By
Solar Observation

A = 46° 28'
D = 5°
R = 1146.0'
T = 492.0'
L = 929.35'
E = 101.14'

C & S Rail Road

Found 3/4" steel pipe laying
on ground at Location of this Corner
977.3

Proposed 30'x54' Culvert
Sta. 651+53


Proposed 24'x56' Culvert
Sta. 634+00 Skew 60° Rt.

RR Structure 2x3 CBC
Rt. 635+62 Drains thru
Roadway Sta. 625+

RR Structure 36" Conc. Pipe
Rt. 640+90 Drains thru
Roadway Sta. 625+

RR Structure 8x6' CBC
Rt. 652+15 Drains thru
Roadway C.M.P. Sta. 651+53

RR Structure 8x6' CBC
Rt. 652+15 Drains thru
Roadway C.M.P. Sta. 651+53

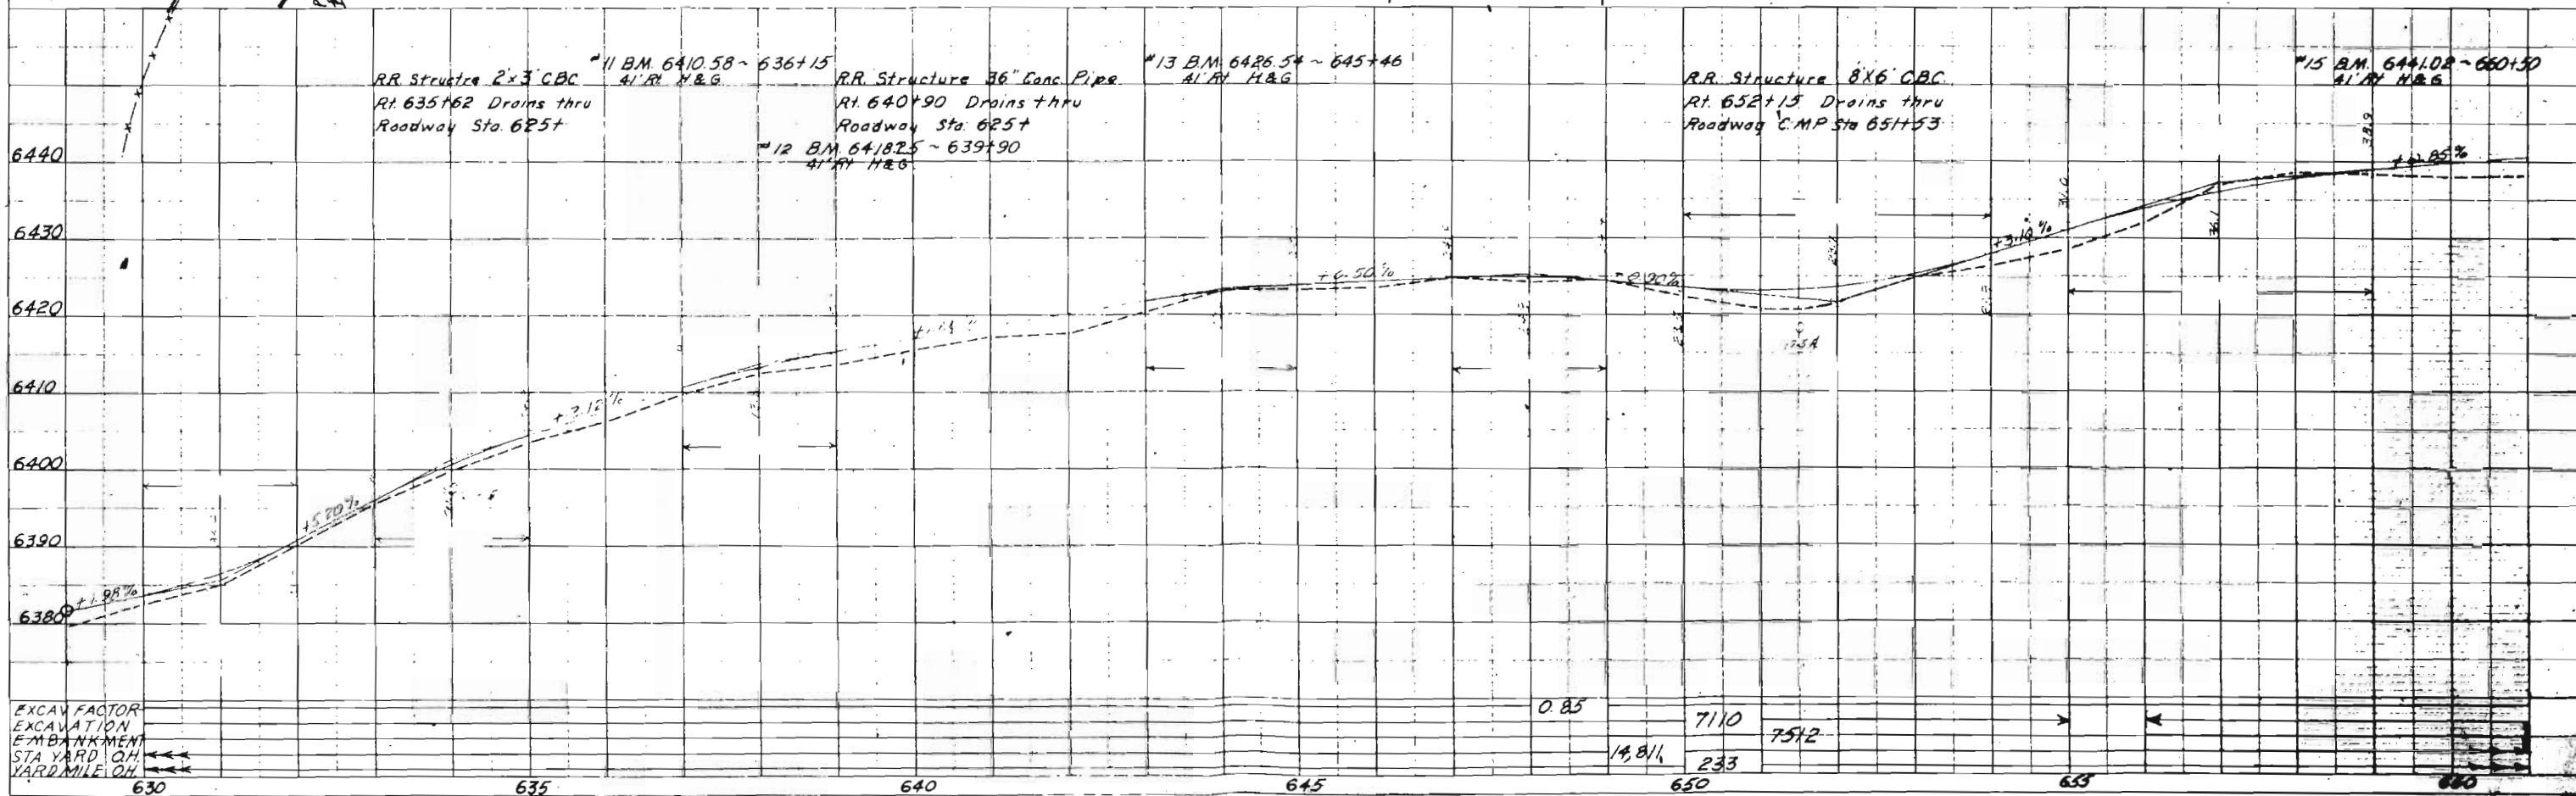

EXCAVATION
EMBANKMENT
STA. YARD OH
YARD MILE OH

PLATE 1 PLAN PROFILE 3 & 2 STANDARD

